Aidite®





Aidite (Qinhuangdao) Technology Co.,Ltd.

Tel: 0086-335-8587898 Fax: 0086-335-8587198 Email: info@aidite.com

CFDA ISO13485 **(€**0197 **FDA**K111291



Introduction

A layer of LiSi Connect is sprayed on the surface of the zirconia bonding surface, and after one sintering, LiSi Connect crystallizes on the surface of the zirconia into a lithium disilicate coating to complete the surface modification of the zirconia. The zirconia treated by LiSi connect has the same clinical bonding effect as glass ceramics, which helps the clinical bonding performance of zirconia.

Advantages

LiSi connect coating is tightly combined with zirconia. ①


Ultra-thin micron-level lithium disilicate coating does not affect clinical placement. ②

Allowing long time stable and durable adhesive bond.


Adhesive force can support zirconia veneer bonding.

Compatible with all zirconia materials.

① LiSi connect will penetrate into zirconia after sintering to produce a strong bonding layer.

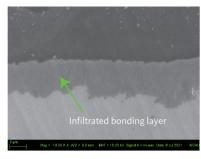


② LiSi connect will form an ultra-thin coating of $6-10\mu m$ on the surface of zirconia, which will not affect the restoration design and clinical placement.

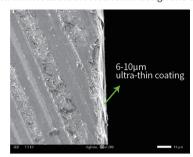


Etching effect

After LiSi connect is sintered on the zirconia surface, the zirconia surface presents a crystal structure similar to that of glass ceramics. After acid etching, it forms a rough porous morphology, achieving the effect of surface roughness.

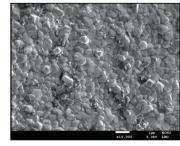

SEM image of original surface of zirconia (x104)

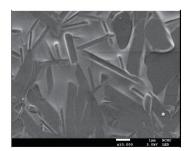

SEM image of zirconia surface after spraying LiSi connect and sintering (x104)



SEM image of LiSi connect coating after acid etching (x10⁴)

Bonding process


- 1. Spray a layer of Biomic LiSi connect on the surface of zirconia restoration after its final sintering, and then do the sintering of LiSi connect according to the specified curve. ③
- 2.Use 5% HF to etch for 90s during acid etching, use air gun and clean water to clean and blow dry.
- 3.Use MDP-containing ceramic treatment agent to evenly coat the bonding surface.
- 4.Use a resin-based adhesive to complete the bonding of the restoration, also the use of pure light-type resin adhesive can prevent the restoration from darkening.

3 Sintering curve

Temp at start (°C)	Drying time	Heating rate	Maximum temp	Holding time	Vacuum	Opening temp
	(min)	(°C/min)	(°C)	(min)	rate	(°C)
450	1	80	890/895/900	1.5	100%	300

Experimental data


Comparison of the bonding strength of zirconia before and after aging under different conditions

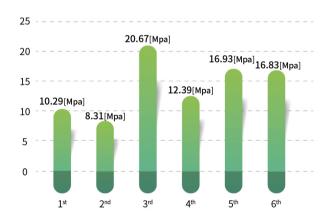

1st Bonding strength of zirconia before aging treatment without any treatment on the bonding surface before.

- 2nd Bonding strength of zirconia after aging treatment without any treatment on the bonding surface before.
- 3rd Bonding strength of zirconia before aging treatment with sandblasting treatment on the bonding surface before.
- $4^{\rm th}$ Bonding strength of zirconia after aging treatment with sandblasting treatment on the bonding surface before.
- 5th Bonding strength of zirconia before aging treatment with LiSi connect treatment and 20 seconds of acid etching before.
- 6th Bonding strength of zirconia after aging treatment with LiSi connect treatment and 20 seconds of acid etching before.

Comparison of the bonding strength of zirconia and glass ceramics under different conditions

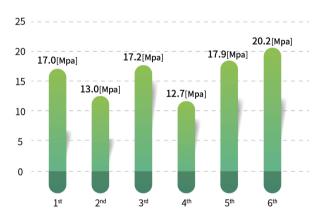

- 1st The average value of bonding strength of each literature for the bonding treatment of glass ceramics by using common clinical bonding method.
- 2nd The average value of bonding strength of each literature for the bonding treatment of zirconia by using Z primer.
- 3rd The bonding strength of Cameo glass ceramic by using common clinical bonding method.
- 4th The bonding strength of Aidite zirconia by using Z primer.
- 5th Bonding strength of zirconia before aging treatment with LiSi connect treatment and 20 seconds of acid etching before.
- 6th Bonding strength of zirconia before aging treatment with LiSi connect treatment and 100 seconds of acid etching before.